


Hand-drawn schematic diagram of a control system for a 3-phase motor. The diagram shows a power supply (PEN, PE, PK) connected to a motor (M) through a series of relays (K1-K15) and contactors (C1-C15). It includes various electrical components like fuses (F1-F15), switches (S1-S15), and a timer (T1). The diagram is labeled with component values and specifications, such as "3NPE, 50Hz, 400/230V/TN-C-S, 2xL2L3-63A" and "3NPE, 50Hz, 400/230V/TN-S, 2xL2L3-40A".

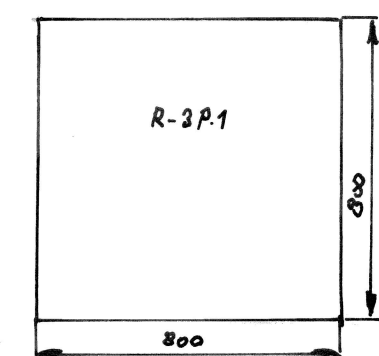

SODPS MATERIALU:

- 1 LS RZP44 E² 2AP4 5T E² F4 53, 800, 800 x 160, 1093
2 LS SPOQOVNICE PE, M- ET 3 + KL 29
2 LS 1 PE, M- ET 4 + KL 7
1 LS 1 PE-LS- 95p
- 23 LS SVORUK RSC
2 LS SVORUK PRER SLR 375/4
1 LS VPRNAC 2- SE- 40/3
1 LS 1 2- SE- 63/3
7 LS JISTIC PLT 06/1
20 LS 4 PLT-D10/1
7 LS 8 PLT-D16/1
2 LS 6 PLT-D17/3
2 LS PROKOPAC OPAKINE PF7-40/4/003
6 LS NUTPLACU RELE ER 111, 25, 154, 230V AC
3 LS STTAC ES 320, 35, 25X, 230V
3 LS 4 ES 220, 25, 25X, 230V
12 LS PAKAC KONT. EP071
3 LS REPOVNICE L1LL 3- 63A
3 LS 4 L1LL 3- 40A
3 LS POMOCHNICE POL L1LL 3
2 LS SESILKALN. RELE PER 610, CP, 166, 230V AC - KVALITA RELE PROH44

PŘÍJEM :	ZEBRICKÁ Y.	Jell								
KP :	(NG. CERNÉ D.									
VĚA PROJEKT:	A RECH. SÁNTAVY T									
						STANEC	408.			
4K SZZ KOMPLÉTNI REKONSTRUKCE CELATNA IS, PRAHA I						DPS	I: 26			
SILNOPROUDÉ ROZVODY - ROZVAHEČ R-3RI						PO-2I/20VC		DECTAY:		
OBJEDNATEL: KARLOVA UNIVERZITA V PRAZE, DIVIZNÍ PRH 3-S, PRAHA I								EL 13		